

Register entry, as of 28 October 2026

Listed for sale

Record ID b8b39bcee11d

2008 Ford Ranger

4.0 L, 6 cylinders · 4WD · Pickup · Gasoline

VEHICLE IDENTIFICATION NUMBER [1]

1FT **ZR45E** **0** **8** **P** **A26173**

WMI 1-3

Ford Motor Company

DESCRIPTOR 4-8

Ranger · 4.0 L

CHECK 9

Verified

YEAR 10

2008

PLANT 11

St. Paul

SERIAL 12-17

Build sequence

§1 IDENTITY [1]

Model year	2008	Engine	4.0 L, 6 cylinders
Make	Ford	Fuel	Gasoline
Model	Ranger	Drive	4WD
Trim	Not in the decode	Maker	FORD MOTOR COMPANY
Body	Pickup	Plant	St. Paul, Minnesota, United States

§2 OBLIGATIONS [2]

cardog.app/tools/recalls/ford/ranger/2008

6 recalls listed by Transport Canada for this model year

Airbag

2021077 19 Feb 2021

Issue: This recall is for certain vehicles that had the driver-front and/or passenger-front airbag inflator replaced after a collision or theft. An obsolete airbag may have been installed. On certain vehicles, long-term exposure to high absolute humidity and temperature, combined with high temperature cycling, may eventually degrade the propellant contained in the driver-front airbag. This could cause the airbag to deploy with more force than normal. If the airbag inflator ruptures, fragments could be propelled toward vehicle occupants or cause damage to the airbag assembly, preventing its proper function. Safety Risk: If the vehicle is involved in a crash requiring an airbag deployment, the airbag inflator could rupture and create a risk of injury. Corrective Action: The company will notify owners by mail and instruct you to take your vehicle to a Ford dealer to inspect the driver and/or passenger airbag inflator or module and replace it, if necessary. Note: The Canadian climate results in the propellant degrading slowly. This recall is being conducted as a precaution to address future risk. It is expected that all airbag inflators will be replaced before their function would be affected.

Airbag

2021029 27 Jan 2021

Issue: On certain vehicles, long-term exposure to high absolute humidity and temperature, combined with high temperature cycling, may eventually degrade the propellant contained in the driver-front airbag. This could cause the airbag to deploy with more force than normal. If the airbag inflator ruptures, fragments could be propelled toward vehicle occupants or cause damage to the airbag assembly, preventing its proper function. Safety Risk: If the vehicle is involved in a crash requiring an airbag deployment, the airbag inflator could rupture and create a risk of injury. Corrective Action: Ford will notify owners by mail. The corrective actions for this recall are under development. Note: The Canadian climate results in the propellant degrading slowly. This recall is being conducted as a precaution to address future risk. It is expected that all airbag inflators will be replaced before their function would be affected.



Airbag

2019005 8 Jan 2019

Issue: On certain vehicles, long-term exposure to high absolute humidity and temperature, combined with high temperature cycling, may eventually degrade the propellant contained in the passenger-front airbag. This could cause the airbag to deploy with more force than normal. If the airbag inflator ruptures, fragments could be propelled toward vehicle occupants or cause damage to the airbag assembly, preventing its proper function. Safety Risk: If the vehicle is involved in a crash requiring an airbag deployment, the airbag inflator could rupture and create a risk of injury. Corrective Actions: Owners will be notified by mail and instructed to take their vehicle to a dealer to have the passenger-front airbag inflator replaced. Note: The Canadian climate results in the propellant degrading slowly. This recall is being conducted as a precaution to address future risk. It is expected that all airbag inflators will be replaced before their function would be affected. Additional note: This recall supersedes recalls 2016-347 (Ford Safety Improvement Program 16S26), 2017-024 (Ford Recall 17S01) and 2018-035 (Ford Recall 18S01). Vehicles repaired under the previous recalls do not require repair under this recall.

Airbag

2017024 12 Jan 2017

On certain vehicles, long-term exposure to high absolute humidity and temperature, combined with high temperature cycling, could eventually degrade the propellant contained in the passenger frontal airbag. This could cause the airbag to deploy with more force than normal. As a result, if the vehicle were involved in a collision that warrants airbag deployment, metal fragments could be propelled toward vehicle occupants, and the airbag assembly could be damaged, preventing proper function. These issues could increase the risk of injury. Correction: Depending on the model, dealers will either replace the passenger frontal airbag inflator or airbag assembly. Note: Canadian climate results in the propellant degrading slowly. The recall is being conducted as a precaution to address future risk, and is expected to replace airbag inflators before their function would be affected. Additional note: This recall is superseded by recall 2019005 (Ford Recall 19S01). Please see <http://wwwapps.tc.gc.ca/Saf-Sec-Sur/7/VRDB-BDRV/search-recherche/detail.aspx?lang=eng&rn=2019005> for more information.

Airbag

2016347 6 Jul 2016

Ford Canada is conducting a voluntary Safety Improvement Program involving passenger airbag inflators in certain vehicles that were originally sold or ever registered in certain high humidity areas of the United States equipped with Takata airbags. Ford will replace the driver or passenger inflator on affected vehicles, depending on the vehicle involved. Owners who believe their vehicles may have been originally purchased or registered in the states of New Jersey, Delaware, District of Columbia, Maryland, Pennsylvania, Ohio, Indiana, Illinois, Virginia, West Virginia, Kentucky, Missouri, Nebraska, Kansas, Oklahoma, Arkansas, Tennessee, North Carolina, Nevada, Arizona, New Mexico, California, Texas, Louisiana, Mississippi, Alabama, Georgia, South Carolina, Florida, Hawaii, Puerto Rico or the U.S. Virgin Islands should contact a Ford dealer. This action is not being conducted under the requirements of the Motor Vehicle Safety Act. Note: This Safety Improvement Program is superseded by recall 2019005 (Ford Recall 19S01). Please see <http://wwwapps.tc.gc.ca/Saf-Sec-Sur/7/VRDB-BDRV/search-recherche/detail.aspx?lang=eng&rn=2019005> for more information.

Lights and instruments

2011251 14 Jul 2011

On certain 2011 Ranger vehicles, the multi-function switch, installed during vehicle assembly, could malfunction and fail. Additionally, other vehicle models may have received the affected switch as a replacement part during service, and are therefore also involved in this campaign. Failure of the multi-function switch could result in a loss of turn signal, tail lamp, hazard warning signal flasher and/or stop lamp function. Failure of these lighting components to illuminate may result in the following road users being unaware of the driver's intentions, as well as reducing vehicle conspicuity during hours of darkness, which could increase the risk of a crash causing property damage and/or personal injury. Correction: Dealers will inspect and, if necessary, replace the multi-function switch.

Listed for the model year, not checked against your VIN. Ford confirms which apply.

Check your VIN with Ford Canada or call a Ford dealer with your VIN.

www.ford.ca/support/recalls/

United States: 6 NHTSA records for this model year, kept apart from the Canadian listing.^[3]



§3 VALUE [4]

This car asks \$13,998^[5], \$5,006 over the median of \$8,992^[4].



Lowest ask	\$4,999
Middle half	\$7,495 – \$15,494
Median ask	\$8,992
This car	\$13,998

Same model year · 7 live listings · as of 28 Oct 2026

OTHER 2008 FORD RANGER LISTINGS [5]

Kelowna, BC · 534,008 km	\$7,495
Toronto, ON · 183,000 km	\$16,990
100 Mile House, BC · 534,008 km	\$7,495
Vernon, BC · 100,005 km	\$16,995
Vancouver, BC · 0 km	\$7,495
Hamilton, ON · 168,500 km	\$8,992

§4 EVENTS

2008	Model year 2008 ^[1] Assembly plant St. Paul, Minnesota, United States
14 Jul 2011	Transport Canada recall 2011251 ^[2] Issued for the model year · Lights and instruments
6 Jul 2016	Transport Canada recall 2016347 ^[2] Issued for the model year · Airbag
12 Jan 2017	Transport Canada recall 2017024 ^[2] Issued for the model year · Airbag
8 Jan 2019	Transport Canada recall 2019005 ^[2] Issued for the model year · Airbag
27 Jan 2021	Transport Canada recall 2021029 ^[2] Issued for the model year · Airbag
19 Feb 2021	Transport Canada recall 2021077 ^[2] Issued for the model year · Airbag
20 Oct 2026	Listed for sale, Victoria, BC ^[5] Jaguar Victoria / Land Rover Victoria · asking \$13,998
27 Oct 2026	Listing last updated ^[5] asking \$13,998



§5 DOCUMENTS

Window sticker We have not collected this label yet.

SOURCES

- | | |
|---|--|
| [1] Cardog identity register, decoded from the VIN | [4] Cardog market quote, same model year, 7 live listings, as of 28 Oct 2026 |
| [2] Transport Canada recall database, listed for the model year | |
| [3] NHTSA recall records (United States), listed for the model year | [5] Live public dealer listings on Cardog, as of 28 Oct 2026 |

STATEMENT OF SCOPE

This record is what public sources held about this vehicle when Cardog read it, each fact cited to its source. It read the VIN decode, Transport Canada's recall listing, NHTSA's recall records, Cardog's market quote and live public dealer listings. Recalls are listed for the model year, not checked against this VIN; the manufacturer confirms which apply. It is not a vehicle history or ownership report, and it carries no owner information.

