

Register entry, as of 29 October 2026

Listed for sale

Record ID 00afb3337994

# 2022 Mercedes-Benz CLS-Class AMG CLS53 4-M+ Turbo

3.0 L, 6 cylinders · Sedan · Gasoline

VEHICLE IDENTIFICATION NUMBER [1]

**W1K 2J6BB 7 N A 101003**

WMI 1-3

Mercedes-Benz Cars

DESCRIPTOR 4-8

CLS-Class · 3.0 L

CHECK 9

Computes

YEAR 10

2022

PLANT 11

Germany

SERIAL 12-17

Build sequence

## §1 IDENTITY [1]

|            |                      |        |                    |
|------------|----------------------|--------|--------------------|
| Model year | 2022                 | Engine | 3.0 L, 6 cylinders |
| Make       | Mercedes-Benz        | Fuel   | Gasoline           |
| Model      | CLS-Class            | Drive  | Not in the decode  |
| Trim       | AMG CLS53 4-M+ Turbo | Maker  | Mercedes-Benz Cars |
| Body       | Sedan                | Plant  | Germany            |

## §2 OBLIGATIONS [2]

[cardog.app/tools/recalls/mercedes-benz/cls-class/2022](https://cardog.app/tools/recalls/mercedes-benz/cls-class/2022)

## 9 recalls listed by Transport Canada for this model year

### Electrical 2024615 18 Oct 2024

Issue: On certain vehicles equipped with 4-wheel drive (4Matic), the transmission wiring harness may not be routed correctly. As a result, water could enter the wiring harness connector and cause a short circuit. Note: This recall is an expansion of Transport Canada recall no. 2024-342.

Safety Risk: A short circuit can create the risk of a fire, even while the vehicle is parked and turned off. Corrective Actions: Mercedes-Benz will notify owners by mail and advise you to take your vehicle to a dealership to replace the transmission wiring harness.

### Electrical 2024342 14 Jun 2024

Issue: On certain vehicles, the recall repairs completed by a Mercedes-Benz dealer during recall 5491309 (Transport Canada recall no. 2022-397) may not have been done correctly. As a result, a second repair is required. On certain vehicles equipped with 4-wheel drive (4Matic), the transmission wiring harness may not be routed correctly. As a result, water could enter the wiring harness connector and cause a short circuit.

Note: This recall replaces Transport Canada recall no. 2022-397. Safety Risk: A short circuit can create the risk of a fire, even while the vehicle is parked and turned off. Corrective Actions: Mercedes-Benz will notify owners by mail and advise you to take your vehicle to a dealership to replace the transmission wiring harness.

### Electrical 2024081 9 Feb 2024

Issue: On certain vehicles, the bolt for the 48 V ground connection may not have been tightened properly. As a result, the wiring could overheat and melt. Safety Risk: Wiring that overheats and melts can create the risk of a fire. Corrective Actions: Mercedes-Benz will notify owners by mail and advise you to take your vehicle to a dealership to inspect and, if necessary, tighten the ground connection.



## Fuel system

2023672 15 Dec 2023

Issue: On certain vehicles, the fuel delivery module could fail. If this happens, the engine may run rough or may not start. This could also result in a sudden loss of engine power while driving. Note: This is an expansion of Transport Canada recall 2023-353. Safety Risk: A sudden loss of engine power could increase the risk of a crash. Corrective Actions: Mercedes-Benz will notify owners by mail and advise you to take your vehicle to a dealership to replace the fuel delivery module.

## Fuel system

2023353 23 Jun 2023

Issue: On certain vehicles, the fuel delivery module could fail. If this happens, the engine may run rough or may not start. This could also result in a sudden loss of engine power while driving. Safety Risk: A sudden loss of engine power could increase the risk of a crash. Corrective Actions: Mercedes-Benz will notify owners by mail and advise you to take your vehicle to a dealership to replace the fuel delivery module.

## Electrical

2022547 29 Sep 2022

Issue: On certain vehicles, the 12 V battery (in the trunk) could move in a crash. As a result, the battery electrical connexions could detach. If this happens, the post-crash safety systems (like the emergency calling (eCall) system, electric seat adjustment, hazard warning lights, and automatic door unlocking) may not work. Safety Risk: Safety systems that don't work correctly could increase the risk of injury. Corrective Actions: Mercedes-Benz will notify owners by mail and instruct you to take your vehicle to a dealership to add a bracket to better secure the battery.

3 more on the model-year record, [cardog.app/tools/recalls/mercedes-benz/cls-class/2022](https://cardog.app/tools/recalls/mercedes-benz/cls-class/2022)

Listed for the model year, not checked against your VIN. Mercedes-Benz confirms which apply.

Check your VIN with Mercedes-Benz Canada or call a Mercedes-Benz dealer with your VIN.

[www.mercedes-benz.ca/en/recalls](https://www.mercedes-benz.ca/en/recalls)

## §3 VALUE [3]

This car asks \$65,724<sup>[4]</sup>, \$369 over the median of \$65,355<sup>[3]</sup>.



|             |                     |
|-------------|---------------------|
| Lowest ask  | \$52,877            |
| Middle half | \$55,622 – \$67,936 |
| Median ask  | \$65,355            |
| This car    | \$65,724            |

Same model year · 8 live listings · as of 29 Oct 2026

## §4 EVENTS

|             |                                                                                           |
|-------------|-------------------------------------------------------------------------------------------|
| 2022        | Model year 2022 <sup>[1]</sup><br>Assembly plant Germany                                  |
| 25 Mar 2022 | Transport Canada recall 2022140 <sup>[2]</sup><br>Issued for the model year · Accessories |
| 20 May 2022 | Transport Canada recall 2022263 <sup>[2]</sup><br>Issued for the model year · Other       |
| 22 Jul 2022 | Transport Canada recall 2022397 <sup>[2]</sup><br>Issued for the model year · Electrical  |



|             |                                                                                                 |
|-------------|-------------------------------------------------------------------------------------------------|
| 29 Sep 2022 | Transport Canada recall 2022547 <sup>[2]</sup><br>Issued for the model year · Electrical        |
| 23 Jun 2023 | Transport Canada recall 2023353 <sup>[2]</sup><br>Issued for the model year · Fuel system       |
| 15 Dec 2023 | Transport Canada recall 2023672 <sup>[2]</sup><br>Issued for the model year · Fuel system       |
| 9 Feb 2024  | Transport Canada recall 2024081 <sup>[2]</sup><br>Issued for the model year · Electrical        |
| 14 Jun 2024 | Transport Canada recall 2024342 <sup>[2]</sup><br>Issued for the model year · Electrical        |
| 18 Oct 2024 | Transport Canada recall 2024615 <sup>[2]</sup><br>Issued for the model year · Electrical        |
| 27 Oct 2026 | Listed for sale, Saint-Jean-Sur-Richelieu, QC <sup>[4]</sup><br>Honda St-Jean · asking \$65,724 |
| 28 Oct 2026 | Listing last updated <sup>[4]</sup><br>asking \$65,724                                          |

## §5 DOCUMENTS

Window sticker      We do not collect window stickers for this manufacturer.

## SOURCES

- |                                                                 |                                                                              |
|-----------------------------------------------------------------|------------------------------------------------------------------------------|
| [1] Cardog identity register, decoded from the VIN              | [3] Cardog market quote, same model year, 8 live listings, as of 29 Oct 2026 |
| [2] Transport Canada recall database, listed for the model year | [4] Live public dealer listings on Cardog, as of 29 Oct 2026                 |

## STATEMENT OF SCOPE

This record is what public sources held about this vehicle when Cardog read it, each fact cited to its source. It read the VIN decode, Transport Canada's recall listing, Cardog's market quote and live public dealer listings. Recalls are listed for the model year, not checked against this VIN; the manufacturer confirms which apply. It is not a vehicle history or ownership report, and it carries no owner information.

